

PARTIAL DISCHARGE TESTING: A PROGRESS REPORT

PD – IMPACT OF LOAD (MW/HP) TO TEST RESULTS

V. Warren, G. Stone and H. Sedding, Qualitrol - Iris Power

1 ABSTRACT

It has long been known that comparing the partial discharge results obtained from a single machine is a valuable tool enabling companies to observe the gradual deterioration of a machine stator winding and thus plan appropriate maintenance for the machine [1]. In 1998, at the annual Iris Rotating Machines Conference (IRMC), a paper was presented that compared thousands of partial discharge (PD) test results to establish the criteria for comparing results from different machines and the expected PD levels [2]. At subsequent annual Iris conferences, using similar analytical procedures, papers were presented that supported and expanded upon the previous criteria [6 - 21]. This paper presents the most recent statistical analysis of the database.

Previous database analyses have only separated results based on voltage class, sensor type and cooling gas pressure. This paper looks deeper by comparing the results based on operating load (MW/HP) and whether this variable should be included in the statistical database.

Disclaimer: The classification of MW/HP was totally dependent on the User's input value and in some cases may have been incorrect. All values were converted to MW for analysis.

Calibration of on-line PD test results is theoretically not possible [3]; therefore, only results obtained using the same method of data collection and noise separation techniques are compared. For this paper, all the data were obtained with a PDA-IV, TGA, Trac or Guard test instrument. Data collected through to the end of 2019 was used; and, as in past papers, it is standardized for frequency bandwidth and pruned to include only the most recent full-load-hot (FLH) results collected for each sensor on operating machines. All questionable data or data from off-line testing or unusual machine conditions were excluded, leaving over 24,000 statistically independent new results collected from about 7,500 machines. The Appendix presents the statistical summary of the latest data to enable Trac, Guard, TGA, and PDA-IV test users to compare on a gross level their test results to those of similar machines.

2 INTRODUCTION

Partial discharges (PD) may occur in electrical insulation systems that operate at 3.3 kV and above. PD only occurs when gas-filled voids are present within the insulation or a gas (usually air) is present on the insulation surface when there is a high electric stress [24]. If the stress is high enough, the gas will experience electrical breakdown, creating a spark consisting of energetic electrons which will break molecular bonds in any organic polymer. Thus, PD will age the insulation and may eventually cause failure. PD occurs in a wide variety of high voltage electrical apparatus such as transformers, gas insulated switchgear, power cables and rotating machines. Since each discharge causes a flow of charge, the PD can be detected by measuring the current pulses on the terminals of high voltage equipment. Off-line PD testing has been as a factory test for almost 100 years on equipment such as power cables. The purpose is to detect flaws created during manufacturing that led to PD, and thus lead to insulation failure. In the past 50 years or so, owners of high voltage equipment are also measuring PD over time on installed equipment. Many aging processes can create voids that can lead to PD, and thus PD is often a symptom of thermal and thermo-mechanical aging processes. By monitoring the evolution of PD over time either in off-line tests or by on-line monitoring while the equipment is operating normally, equipment owners have a powerful tool for determining when maintenance or equipment replacement is needed. More commonly, machine owners have been using off-line and on-line PD testing to assess the condition of the stator winding insulation to determine if maintenance is needed. Problems such as loose coils in the stator slots, contamination leading to electrical tracking and thermal aging of the insulation are easily detected [25][26]

There are many different types of PD testing equipment that have been used for coils and stator windings. Most use a capacitor to detect the PD pulse currents in the presence of the 50/60 Hz high voltage. The instrumentation to measure the PD current pulses most commonly includes an analog to digital converter that determines the number, magnitude and phase position (with respect to the 50/60 Hz ac cycle) of the PD. However almost every brand of PD detector works in a different part of the frequency spectrum. Since each

partial discharge pulse is the result of a brief flow of electrons lasting only a few nanoseconds, by the Fourier transform, frequencies from 0 Hz up to several hundred MHz are created by each discharge. Thus, PD can be detected in a very wide range of frequencies, and this will impact what is measured. Only instruments using very high frequency (VHF) bandwidths, 30-300MHz, are included in this paper [25].

2.1 PD - A COMPARISON TEST

Partial discharges (PD) are small electrical sparks that occur when voids exist within or on the surface of high voltage insulation of stator windings in motors and generators. These PD pulses can occur because of the manufacturing/installation processes, thermal deterioration, winding contamination or stator bar movement during operation. As the insulation degrades, the number and magnitude of PD pulses will increase. Although the magnitude of the PD pulses cannot be directly related to the remaining life of the winding, the doubling of PD pulse magnitudes approximately every 12 months has been used as a “rule of thumb” to indicate rapid deterioration is occurring [26]. If the rate of PD pulse activity increases rapidly, or the PD levels are high compared to other similar machines, this is an indicator that visual inspections and/or other testing methods are needed to confirm the insulation condition [4]. Furthermore, if the PD magnitudes by the same test method from several identical windings are compared, the windings exhibiting higher PD activity are generally closer to failure [1]. This paper examines the validity of this approximation.

2.2 PREVIOUS PAPERS

The conclusion of previous papers was that when comparing PD data results from different machines, the following parameters must remain constant: [2] [4][5][6]

- Test instrument bandwidth and noise separation techniques [1998]
- Type of sensors [1998, 1999, 2006, 2009]
- Operating voltage of the machines [1998, 2005, 2006, 2013]
- Operating gas coolant of the machines – PD is pressure dependent [1998, 2002, 2006, 2015]
- PD levels appear to be influenced by the quality of design, manufacturing, and installation, and not solely operating hours or operating condition [2000, 2001, 2004, 2007, 2008, 2010, 2014]
- Impact of ambient conditions [2012]
- Impact of resin penetration method, GVPI vs VPI [2018]
- Utility versus Industrial application [2019]

Not as significant are:

- Type of insulation system [2000, 2003, 2006]
- Machine type [1998, 1999, 2000, 2005]
- Winding type [1998, 1999, 2000, 2005]

Differences in operating loads and temperatures could also affect the results, but these were dependent on the condition of the stator winding and therefore, would only be applicable when comparing the PD results obtained from a single machine, not when comparing results from different machines.

3 COLLECTION OF DATA

3.1 PD TEST METHOD

During normal machine operation, the VHF instrument called the PDA-IV or TGA is temporarily connected or a Guard system is continuously connected to the previously installed sensors in each phase. The sensor blocks the power frequency voltage, and passes the high frequency voltage pulse accompanying partial discharge. To avoid any confusion with electrical noise from power tool operation, corona from the switchgear, RF sources, etc., the PDA-IV, TGA or Guard separates PD from system noise and disturbances based on time-of-arrival and pulse characteristics, and measures the number, magnitude and ac phase position of the PD pulses.

3.2 DATA PRESENTATION

Two types of plots are generated for each partial discharge test. The first type of plot is two-dimensional (2-D), where the number of partial discharges per second versus PD magnitude is displayed. The greater the number of pulses per second, the more widespread is the deterioration in the winding. The higher the PD magnitude, the more severe is the deterioration. The second type of plot is three-dimensional (3-D), where the quantity (vertical scale) and magnitude (scale coming out of the page) of the PD versus the ac phase angle (horizontal

scale) are displayed. Experience has indicated that such pulse phase analysis can be used to identify if multiple deterioration mechanisms are occurring, and what the mechanisms are.

The 2-D and 3-D plots are unwieldy for making comparisons amongst the machines. The PDA-IV or TGA summarizes each plot with two quantities: the peak PD magnitude (Qm) and the total PD activity (NQN). The Qm is defined to be the magnitude corresponding to a PD repetition rate of 10 pulses per second. Qm relates to how severe the deterioration is in the worst spot of the winding, while the NQN is proportional to the total amount of deterioration and is similar to the power factor tip-up. Since the Qm scalar quantity is more indicative of how close the winding is to failure, the peak magnitude (Qm) will be used throughout this paper for comparisons [25].


3.3 2019 DATABASE

After the accumulation of all available test data through 2019 with over 685,000 records from tests using portable instruments only, a database was carefully compiled using the following selection criteria:

- only on-line tests obtained during normal operation
- only one test result per sensor
- the most recent test at Full Load and Hot stator winding temperature (FLH)
- any test with questionable results was discarded
- Once these criteria were applied, over 24,000 statistically independent test results from over 7,500 assets were analyzed.

The following tables show the breakdown of the results that were retained once non-FLH and repeat tests were discarded.

<i>Number of FLH Tests by Machine Type</i>	
Motors	32%
Hydros	24%
Turbos	43%

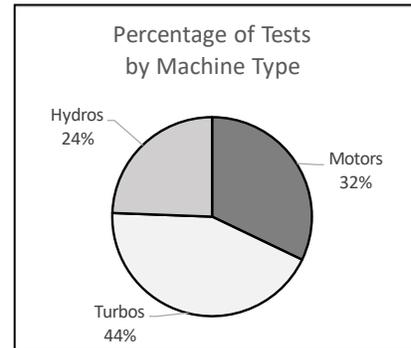

The appendix shows the updated statistical distribution of peak PD magnitudes for various voltage classes and sensor types.

3.4 STATISTICAL ANALYSIS

The database was analyzed to determine the effect on Qm of several different factors, including:

- Sensor installation
- Voltage class
- Hydrogen Pressure

The range in Qm from all the tests for the operating voltage was established for each set of the above factors. A sample of the statistical distribution is shown in Table 1. For example, for 13-15 kV stators in turbine generators or motors, 25% of tests had a Qm below 51 mV, 50% (the median) had a Qm below 115 mV, 75% were below 235 mV and 90% of tests yielded a Qm below 430 mV. Thus, if a Qm of 500mV is obtained on a 13.8 kV motor or turbine generator, then it is likely that this stator will be deteriorated, since it has PD results higher than 90% of similar machines. In fact, in over two hundred cases where a machine was visually examined after registering a PD level >90% of similar machines, significant stator winding insulation deterioration was observed [23].

Table 1. Distribution of Qm for Air-Cooled Stators, 80 pF Sensors on the Terminals (TGA)

Oper kV	2 - <6kV	≥6 <10kV	≥10 <13kV	≥13 <16kV	≥16 <19kV	≥ 19kV
25%	10	25	35	51	39	40
50%	20	67	85	115	80	96
75%	59	145	196	235	207	225
90%	209	331	415	430	313	566
95%	358	507	670	619	486	842

Table 2 illustrates the similar statistical distribution for hydrogen-cooled turbo generators where stator slot couplers (SSC) capacitors are installed. For these, both the operating voltage and gas pressure influence the

results. Similar tables have also been prepared for air and hydrogen-cooled machines with other types of PD sensors and can be found in the appendix of this paper.

Table 2. Distribution of Qm for Gas-Cooled Stators using SSC sensors – Slot PD

Oper V	≥13 <16kV			≥16 <19kV			≥19 <23kV			≥23 <26kV	
H2 (kPa)	76-138	145-207	Over 207	75-207	214-345	Over 345	75-207	214-345	Over 345	214-345	Over 345
H2 (psi)	11-20	21-30	31-50	11-30	31-50	> 50	11-30	31-50	>50	31-50	>50
25%	0	0	0	0	0	0	0	0	0	0	0
50%	1	1	2	2	0	0	8	1	1	0	0
75%	16	8	16	12	5	3	34	14	6	16	6
90%	57	35	41	32	30	8	149	47	21	56	16
95%	97	85	53	49	56	13	629	68	39	117	30

With these tables, it is now possible, with only an initial test for motor and generator owners, to determine if the stator winding insulation has a problem. If the PD is higher than that found on 90% of similar machines, then off-line tests and/or a visual inspection would be prudent. Continuous PD monitors should have their alarm levels set to the 75% for 4kV rated and below and the 90% level for above 4kV rated assets.

4 MW/HP (LOAD) IMPACT TO PD RESULTS

Since the origin of global data collection for the comparative database in 1998, Iris Power has maintained that the rated load (MW) had minimal, or at least, unpredictable impact to the statistical analysis of the PD magnitudes. However, as it is known that for some issues, particularly coil/bar movement, variability in operating load would likely have a significant impact to PD magnitudes; then only the most recent full-load-hot (FLH) tests were evaluated for each asset.

4.1 DATA VISUALATION

Using the operating load values extracted from the plant’s DCS for continuous instruments or entered by the user for portable instruments, the following plots of PD levels versus operating load for the two most common installations and assets were evaluated: air-cooled hydrogenerators and air-cooled turbine generators. The comparisons are of the maximum Qm values average, standard deviations, and selective percentile rankings. [Figure 1]


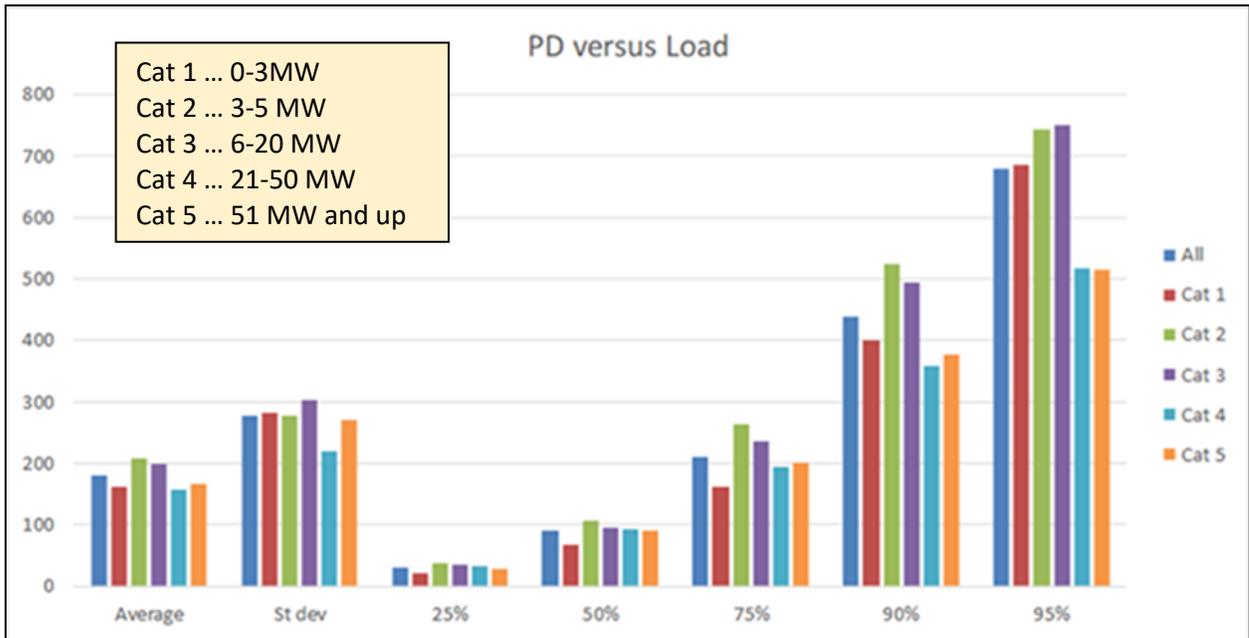


Figure 1. Operating load (MW) versus PD for Air-cooled assets

The plots below compare the impact of Voltage (kV) versus PD (Figure 2 and Figure 4) and Load (MW) versus PD (Figure 3 and Figure 5) for each of the two asset/sensor categories of air-cooled hydrogenerators (Differential/PDA) and turbine generators (Directional/BUS).

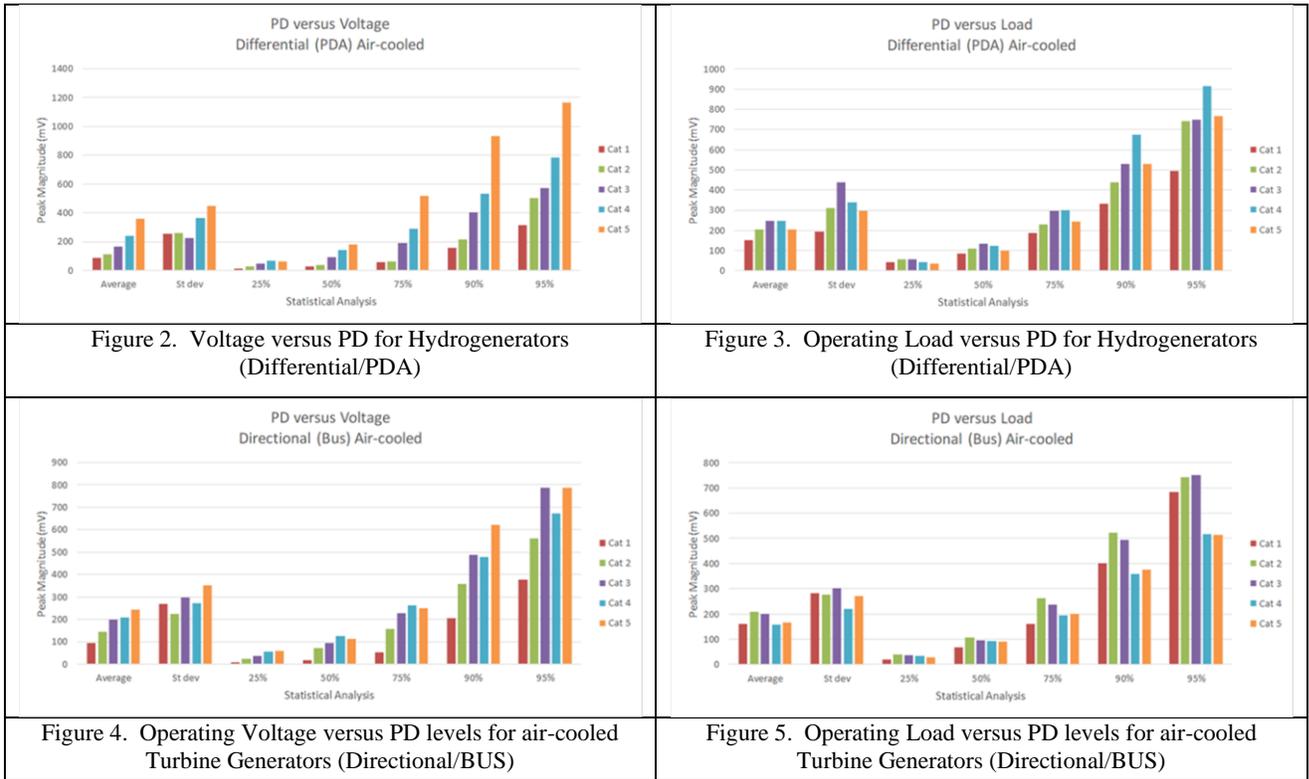

4.2 DISCUSSION

Figure 1 depicts minimal difference between the averages and standard deviations across the varying load categories for air-cooled generators. This is also true for most of the results, up to 75% of the results. The PD magnitudes may have “weak” dependence on load in the 90th and 95th percentiles, but as these are the most “damaged” windings then the volatility is most likely due to the type and extent of stator winding deterioration.

Figure 2 and Figure 4 illustrate a relatively “strong” correlation between voltage and PD for the averages, standard deviations, and load categories. On the other hand, Figure 3 and Figure 5 are similar to Figure 1, where the correlation between load and PD appears weak.

5 CONCLUSION

Comparison of the PD results based on operating load lead to the following possibilities:

- Impact of Load to PD results
 - As found before, operating kV has a big impact on the Qm distribution. There is some impact from machine MW load, but it is much less significant and inconsistent.
 - PD Alert levels are mainly determined by voltage, pressure, and sensor type/installation. Though there is a load effect, it is weak.
 - It is understood that the main variable that explains most of the variation is the type and extent of deterioration in each stator – and this is not captured in these analyses.

Though it is always recommended that you trend the results for one machine over time and thus monitor the rate of degradation of the stator winding, it is also possible to compare results from similar machines. If the test instrument is a TGA, PDA-IV, Trac or Guard and the sensors are either 80pF capacitors, or stator slot couplers, then the tables contained within the appendix can be used to ascertain whether a machine warrants further tests and inspections or is operating within reasonable limits. Yellow flags should only be raised if the PD levels on

a specific machine are above the 90th percentile (High). In all cases, raising the flag means increasing the frequency of PD testing to determine the rate of deterioration and when possible, conduct specialized tests, inspections and repairs as required. In mica-based insulation systems, PD is a symptom of a failure mechanism; action should be based on the severity of the failure mechanism detected by the PD, not the PD results. PD levels exceeding threshold alarms are warnings for further investigation to determine the cause of the high PD; however, be aware that PD levels can fluctuate with ambient and operating conditions. Maintenance should be based on the cause of the PD, not the overall levels. Continuous PD monitors should have their alarm levels set to the 75% or 90% level.

The time of winding failure is normally the result of a deteriorated winding being subjected to an extreme stress such as a lightning strike, out-of-phase synchronization, excessive starts, or system imbalance. As these are unpredictable, it is impossible to forecast when a failure will occur. However, by monitoring the PD characteristics of a stator winding, it is often possible to determine which machines are more susceptible to failure, and therefore which require maintenance.

6 REFERENCES

- [1] J.F. Lyles, T.E. Goodeve, and G.C. Stone, "Using Diagnostic Technology for Identifying Generator Winding Maintenance Needs," *Hydro Review Magazine*, June 1993, pp. 59-67.
- [2] V. Warren, "How Much PD is Too Much PD?" *Proc. Iris Rotating Machine Conference*, Dallas, TX, March 1998.
- [3] IEEE 1434-2014 "IEEE Guide to the Measurement of Partial Discharges in Rotating Machinery."
- [4] V. Warren, G.C. Stone, "Recent Developments in Diagnostic Testing of Stator Windings," *IEEE Electrical Insulation Magazine*, September 1998.
- [5] V. Warren, "Further Analysis of PD Test Results" *Proc. Iris Rotating Machine Conference*, Scottsdale, AZ, March 1999.
- [6] To [22]..... V. Warren, "Partial Discharge Testing – A Progress Report" *Proc. Iris Rotating Machine Conference 2000-2019*.
- [23] Maughan, C.V. "Partial discharge-a valuable stator winding evaluation tool", *Electrical Insulation, 2006. Conference Record of the 2006 IEEE International Symposium on*, On page(s): 388 - 391
- [24] IEC 60270, "High Voltage Test Techniques. Partial Discharge Measurements.", 2015
- [25] IEC TS 60034-27, "Off-line partial discharge measurements on the stator winding insulation of rotating electrical machines", 2006
- [26] IEC TS 60034-27-2 "On-line partial discharge measurements on the stator winding insulation of rotating electrical machines", 2012.

7 APPENDIX – DATA ANALYSIS OF RESULTS THRU 2019

The following summarizes the analysis of the PD levels, given by Qm number, for all data collected with Iris equipment up to the end of the year 2019 with over 685,000 results. Since it has been well established that it is ambiguous to compare PD results obtained using different types of sensors [3], data analysis requires separation of the database based on sensor type. The two basic types of sensors used in the data collection are: 80pF capacitors (cable-type and epoxy-mica type) and stator slot couplers (SSC). Furthermore, data will be separated based on gas cooling pressure and operating voltages.

7.1 CAPACITORS – (AIR-COOLED MACHINES)

The most widely employed sensors are the 80pF couplers used on motors, hydro-generators, and small turbine generators. There are two methods of sensor installation for the capacitive couplers, the directional (TGA) and the differential (PDA) methods.

7.1.1 Directional Method (TGA)

The directional method is used primarily on motors and small turbine generators and occasionally on small hydro-generators.

Qm values for air-cooled machines with directional capacitive couplers (TGA)

Rated kV	< 6	≥ 6 < 10	≥ 10 < 13	≥ 13 < 16	≥ 16 < 19	≥ 19	
25%	10	25	35	51	39	40	25% of the results have Qm levels below this value
50%	20	67	85	115	80	96	50% of the results have Qm levels below this value
75%	59	145	196	235	207	225	75% of the results have Qm levels below this value
90%	209	331	415	430	313	566	90% of the results have Qm levels below this value
95%	358	507	670	619	486	842	95% of the results have Qm levels below this value

As shown here, the majority, 75%, of the results obtained with the directional mode installation (BUS) of capacitive couplers are below ~200mV for machines rated less than 12kV, 235mV for machines rated 13-15kV, 207mV for 16-18kV, and 225mV for those >19kV.

Additionally, there is an approximate doubling of the Qm levels between the 75% and the 90%, which supports the definition of *rapid deterioration* as doubling over a twelve-month interval [IEC 60034-27-2]. There are a few machines with PD much higher than the 90th percentile with Qm levels >500-900mV. These machines are suspected to have significant deterioration.

7.1.2 Differential Method (PDA)

The differential method is used primarily on large hydro-generators having an internal circuit ring bus.

There are two major differences in the directional and differential installations: one is the method of time-of-arrival noise separation and the second is the actual location of the couplers. Since both time-of-arrival noise separation techniques work similarly, this difference should have little impact to the test results.

However, the difference in the sensor locations can greatly affect the results. A differential (PDA) installation in a larger hydro-generator uses sensors normally placed within one meter of the junction between the incoming phase bus and the first coil/bar in the circuit. A sensor at this location will be extremely sensitive to any pulses originating within the coil/bar since the magnitude of the pulse will be amplified when it reaches the impedance mismatch between the bus and the coil/bar. Thus, it is reasonable to assume the results obtained with the couplers at this location will be higher than when the couplers are located outside the machine housing typical of directional (TGA-BUS) installations. However, when comparing the directional (TGA) results to the differential (PDA) results, though there are some minor variances, there is little significant difference between the statistical summaries for windings rated less than 16kV. Thus, it is safe to say that for a 13.8kV winding, regardless of installation type, the PD levels should be less than ~250mV and those machines with PD higher than 500mV need further investigation.

Qm values for air-cooled machines with differential capacitive couplers (PDA)

Rated kV	<10	≥10 <13	≥13 <16	≥16 <19	≥ 19	
25%	10	38	38	39	52	25% of the results have Qm levels below this value
50%	25	72	97	131	146	50% of the results have Qm levels below this value
75%	51	132	202	338	380	75% of the results have Qm levels below this value
90%	149	289	387	625	837	90% of the results have Qm levels below this value
95%	285	452	580	856	1094	95% of the results have Qm levels below this value

7.2 CAPACITORS – (GAS-COOLED) (TGA)

Since the occurrence of PD is extremely dependent on the electrical breakdown point of the gas medium, PD results from air-cooled machines are typically higher than machines cooled with either hydrogen or pressure carbon dioxide. Therefore, it is not advisable to compare the results from machines using different gas mediums. Since most hydro-generators (PDA installations) are air-cooled, all the tests for gas-cooled machines with capacitors were obtained using a TGA instrument and directional sensor installation. Most of the hydrogen-cooled machines have high rated loads and frequently suffer from problems with the core iron arcing. PD or noise activity at the machine terminals, outside the hydrogen environment, can make stator winding insulation condition difficult to interpret. As a result, stator slot couplers (SSC) are the recommended sensors in these applications to avoid misdiagnosis resulting from the capacitive sensor detecting core-iron problems in addition to stator winding problems.

Qm values for non air-cooled machines with directional capacitive couplers (TGA)

Rated kV	<16 ¹				≥16 <18				≥ 19		
	H2 (kPa)	76-138	145-207	214-345	Over 345	76-138	145-207	214-345	Over 345	145-207	214-345
H2 (psig)	11-20	21-30	31-50	>=51	11-20	21-30	31-50	>=51	21-30	31-50	>=51
25%	26	19	14	8	32	27	12	13	41	12	10
50%	67	41	31	19	123	41	32	28	88	41	31
75%	166	93	67	76	216	158	89	53	121	85	91
90%	359	182	179	148	397	435	207	125	193	145	377
95%	603	272	415	194	513	956	335	307	226	169	807

As expected, the PD results for gas-cooled machines are much lower than for the air-cooled machines. This is especially observable at higher pressures, where 75% of the tests for all operating voltages operated above 31psig are below 100mV and 90% generally below ~200mV, less than observed on the air-cooled machines (Section 7.1.1). At the lower operating pressures, the PD levels are generally much higher, with a few machines having extremely high PD of Qm levels >400mV, which would require more tests and investigation.

¹ Fluctuations from previous years due to a large influence by one or more manufacturers

7.3 STATOR SLOT COUPLERS (SSC) – (GAS-COOLED)

Qm values for non air-cooled machines with SSC sensors- Slot PD

Rated kV	<16 ²				≥16 <18			≥ 19 < 23			≥ 23	
H2 (kPa)	76-138	145-207	214-345	> 345	75-207	214-345	>345	75-207	214-345	> 345	214-345	> 345
H2 (psi)	11-20	21-30	31-50	> 50	11-30	31-50	> 50	11-30	31-50	>50	31-50	>50
25%	0	0	0	0	0	0	0	0	0	0	0	0
50%	1	1	2	1	2	0	0	8	1	1	0	0
75%	16	8	16	6	12	5	3	34	14	6	16	6
90% ³	57	37	41	15	32	30	8	149	47	21	56	16
95% ²	97	85	53	32	49	56	13	629	68	39	117	30

The preferred sensor for turbine generators rated higher than 100MVA is a stator slot coupler (SSC). The sensor is placed within the slot of the highest voltage bar either directly beneath the wedge or between the top and bottom bars in the slot. There is little difference in the results obtained from the two installations [2]. Since these machines are operating in a hydrogen environment, the overall slot PD is quite low relative to the air-cooled windings. It should be observed that though most of the machines have slot Qm values less than ~30mV, there are a few with levels higher than 60-200mV. These should be subjected to further tests and inspections. The SSC is a high frequency antenna that detects the pulses and through pulse analysis, the TGA can discriminate between pulses originating in the high voltage insulation and those from core-iron arcing or external sources. Furthermore, the SSC/TGA test setup can identify whether the PD originates in the slot or in the endwinding [15]. The endwinding PD is slightly lower than the slot PD, with 90% of all the tests less than ~20mV. There are, however, a few machines with Qm levels higher than 25mV, and these machines require additional attention.

Qm values for non air-cooled machines with SSC sensors- Endwinding PD

Rated kV	<16				≥16 <18			≥ 19 < 23			≥ 23	
H2 (kPa)	76-138	145-207	214-345	> 345	75-207	214-345	>345	75-207	214-345	> 345	214-345	> 345
H2 (psi)	11-20	21-30	31-50	> 50	11-30	31-50	> 50	11-30	31-50	>50	31-50	>50
25%	0	0	0	0	0	0	0	0	0	0	0	0
50%	0	0	1	0	0	0	1	0	0	1	0	0
75%	1	1	5	1	3	1	4	1	3	6	1	3
90%	10	6	13	7	11	6	9	8	11	16	13	7
95%	20	10	23	27	17	16	16	10	17	31	51	16

7.4 STATOR SLOT COUPLER – (AIR-COOLED)

Qm values for air-cooled machines with SSC sensors

Slot PD			Endwinding PD		
Rated kV	<16	≥16 <24	Rated kV	<16	≥16 <24
25%	0	0	25%	0	0
50%	2	0	50%	1	0
75%	29	10	75%	9	1
90%	81	48	90%	42	8
95%	144	125	95%	60	17

There are a few air-cooled machines being monitored with stator slot couplers. As previously described, because of the differences in the electrical breakdown points of the gas mediums, it is not recommended to compare results from air-cooled machines to those from gas-cooled ones. It is not surprising that the PD levels for the air-cooled machines with SSCs are generally higher than the gas-cooled ones. Most of these machines have slot Qm levels less than ~30mV, but there are a few with extraordinarily high slot PD, >90mV, that would require further investigation.

² Fluctuations from previous years due to a large influence by one or more manufacturers